

DAYTON, OHIO

AL-5042 (FAA)

22307

WAAS CH 93601 W20A	APP CRS 206°	Rwy Idg 4410 TDZE 955 Apt Elev 957
--	------------------------	---

RNAV (GPS) RWY 20
DAYTON/WRIGHT BROTHERS (MGY)

RNP APCH.


T Inoperative table does not apply. When local altimeter setting not received, use James M Cox Dayton Intl altimeter setting and increase all DAs/MDAs 60 feet and Circling Cat C/D visibility $\frac{1}{4}$ SM. Rwy 20 helicopter visibility reduction below $\frac{3}{4}$ SM NA. VDP NA when using James M Cox Dayton Intl altimeter setting.

MALS



MISSED APPROACH:
Climb to 3100 direct
SOVVO and hold.

ASOS 118,375	COLUMBUS APP CON 118.85 269,275	CLNC DEL 119.4	UNICOM 122.8 (CTAF) 0
------------------------	---	--------------------------	---------------------------------

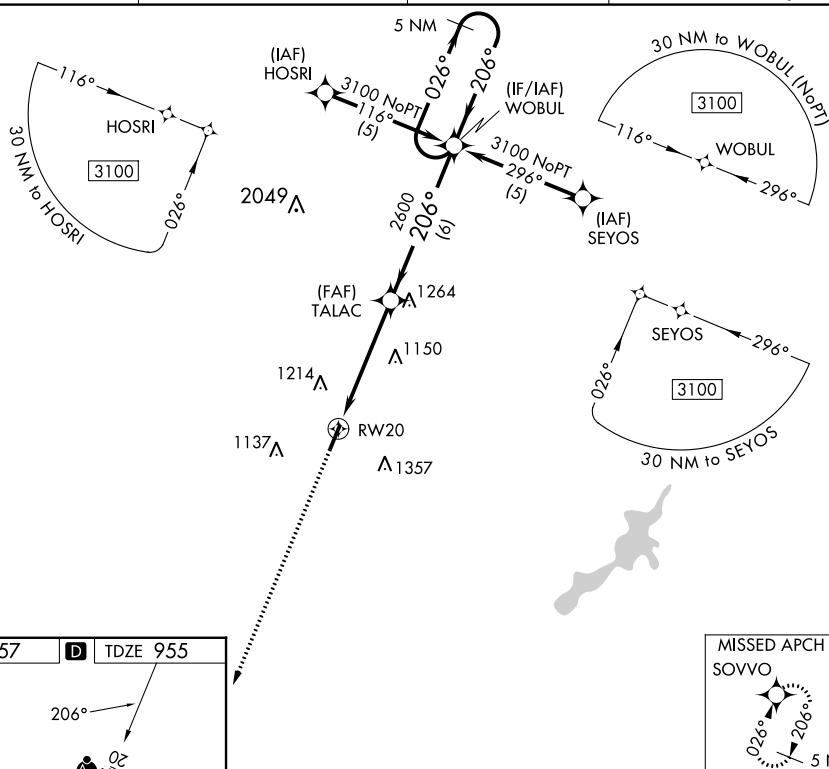

3100 SOVVO 		5 NM Holding Pattern	
* LNAV only.			
CATEGORY	A	B	D
LPV DA	1294-1¼ 339 (400-1¼)		
LNAV MDA	1440-1 485 (500-1)	1440-1¼ 485 (500-1¼)	1440-1½ 485 (500-1½)
CIRCLING	1480-1¼ 523 (600-1¼)	1520-1¼ 563 (600-1¼)	1660-2 703 (800-2)
		1660-2 703 (800-2)	1660-2 ¼ 703 (800-2 ¼)

DAYTON, OHIO
Orig-B 30JAN20

39°35'N-84°13'W

DAYTON/WRIGHT BROTHERS (MGY)
RNAV (GPS) RWY 20

EC-2, 22 FEB 2024 to 21 MAR 2024